

# Manhole Inspection Summary

Manhole # S05CC\_003MH

Printed On: 6/24/2010

Page 1 of 3

**Inspection** ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **05CC** Node: **003** Status: **Found**

Insp Date: **3/6/08 11:26 AM**

Incomplete Comments

Crew: **BC CB**  
Inspector: **Chung**  
Firm: **URS**

**Location** Address: **4132 STOKES DRIVE**

Cross Street: **MOUNTWOOD  
WILDWOOD ALLEY**

**Manhole** Type: **Terminal**

Location: **Sidewalk**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **Sheeting**

Comments

**Cover**

Shape: **Circular**

Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame**

Offset: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

**Chimney / Frame Adjustment**

☒ Exists Material: **Brick and Stone** ☐ Parged Height: **6** (in.)

Condition: ☐ Sound ☐ Cracked ☒ **Root Intrusion** ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Corbel**

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Barrel**

Material: **Brick**

☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Bench**

☒ Exists Material: **Brick**

☐ Parged

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

**Channel**

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Steps**

Count: **5** Missing: **0** ☒ **Corroded**


**Surcharge**

☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

Location View



Top View

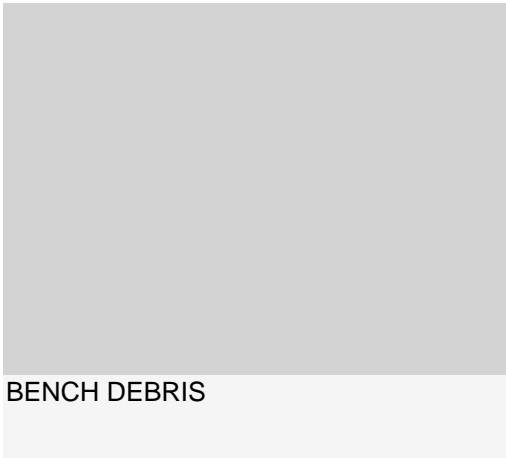


BENCH DEBRIS

GRADE ADJUSTMENT




Defect 2

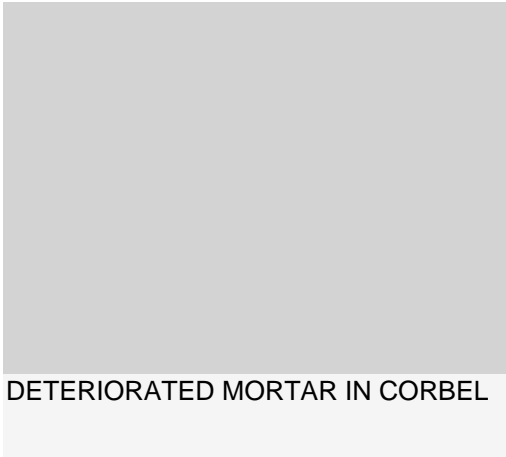

DETERIORATED MORTAR IN CORBEL

Defect 1

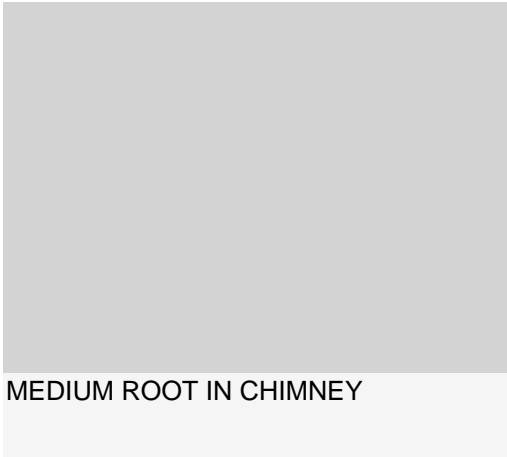

MEDIUM ROOT IN CHIMNEY

## Manhole Inspection Summary

Manhole # S05CC\_003MH

Printed On: 6/24/2010

Page 3 of 3

8 in. Circular Gravity Sewer  
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **10.70** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**


Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer  
Pipe In @ 3 O'Clock

3 O'Clock Inflow



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **10.20** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection